

CHEVROLET—CENTRAL OFFICE

DIVISION OF GENERAL MOTORS CORPORATION
DETROIT 2, MICHIGAN

TECHNICAL SERVICE BULLETIN

Technical Service Department



SUBJECT: INTERMEDIATE DOOR HANDLE RUBBER BUMPER
RETENTION - GREENBRIER AND CORVAN MODELS

BULLETIN NO. DR #455

SECTION I

TO: ALL CHEVROLET DEALERS

DATE November 17, 1960

On early production Greenbrier Sportswagons and Corvans, the intermediate Door Handle Rubber Bumper was retained in the handle with cement. In some instances, this retention was unsatisfactory.

Positive retention of the rubber bumper may be accomplished as follows:

1. Rework bumper by drilling a hole through the center with a 1/4" drill. See sketch on Pg. 2.
2. With a #20 drill (5/32" if #20 not available) make a hole 5/8" deep in the center of the door handle. See sketch.
3. Attach the bumper to the intermediate door handle with #178849 screw, making sure that screw is bottomed in hole.

Director, Technical Service Department

JCP:dz



USE
1/4 DRILL

