

MR. D. C. WILSON
CHEVROLET MOTOR DIVISION
GENERAL MOTORS CORPORATION
P. O. BOX 1439
OAKLAND 4, CALIFORNIA

6-8
CHEVROLET—CENTRAL OFFICE
DIVISION OF GENERAL MOTORS CORPORATION
DETROIT 2, MICHIGAN
ORR



TECHNICAL SERVICE BULLETIN

Technical Service Department




SUBJECT: BACK-UP LIGHT SWITCH INTERFERENCE -
1961-63 CORVAIR W/4-SPEED TRANSMISSION

BULLETIN No. TSB #898
DR #598

SECTION XII

TO: ALL CHEVROLET SERVICE PERSONNEL

June 7, 1963

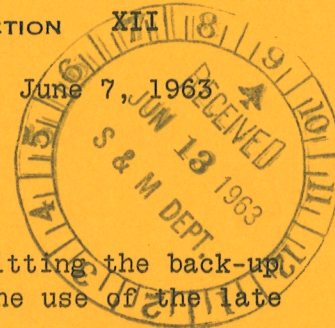

Complaints of the transmission shifter shaft hitting the back-up light switch on subject models may be due to the use of the late design switch with an early design gasket.

Installing the late design switch Part No. 1993619 with an early design gasket Part No. 3788157 will bring the hex section of the switch in line with the transmission shifter shaft and cause an interference condition. Using the late design gasket Part Number 3833294 will correct this condition.

If switch replacement is necessary, use Part No. 1993619 Switch with Part No. 3833294 Gasket which is thicker and may be identified by its orange color.

PARTS DATA

<u>Part No.</u>	<u>No. Required</u>	<u>Description</u>
1993619	1	Back-up Switch - 1961-63 Corvaire W/4-Speed Trans- mission
3833294	1	Gasket - Back-up Switch

Director, Technical Service Department

ADJ/afm
c: TSB List